



Photo ID 551 (U/S)



Segment 420 – Right Bank

Riverbank Features	Characteristics
Upper Riverbank Slope	Steep
Upper Riverbank Height	High
Upper Riverbank Sediment	Silt/Sand
Upper Riverbank Vegetation	Heavy
Lower Riverbank Slope	Flat/Beach
Lower Riverbank Sediment	Gravel
Lower Riverbank Vegetation	Moderate
Type of Erosion	
Potential Erosion Indicators	Overhanging bank, Exposed roots
Stage of Erosion	Stable
Extent of Erosion	None/Little

**QA Observations:** Upon review of the photos for this segment, classification made in the field was confirmed and additional indicators of potential future erosion were included.



Photo 546 Location





Photo ID 966 (mid-segment)





Photo ID 965 (D/S)



Photo ID 967 (middle)





Photo ID 968 (middle)



Photo ID 969 (middle)





Photo ID 970 (middle)



Photo ID 971 (U/S)



Segment 430 – Right Bank

Riverbank Features	Characteristics
Upper Riverbank Slope	Moderate
Upper Riverbank Height	High
Upper Riverbank Sediment	Silt/Sand
Upper Riverbank Vegetation	Heavy
Lower Riverbank Slope	Flat/Beach
Lower Riverbank Sediment	Cobbles
Lower Riverbank Vegetation	None to very sparse
Type of Erosion	Undercut
Potential Erosion Indicators	Creep/Leaning trees, Exposed roots
Stage of Erosion	Stable
Extent of Erosion	None/Little

**QA Observations:** Upon review of the photos for this segment, classification made in the field was confirmed and additional indicators of potential future erosion were included.



Photo 966 Location





Photo ID 1004 (photo covers most of segment)



Segment 440 – Right Bank

Riverbank Features	Characteristics
Upper Riverbank Slope	Moderate
Upper Riverbank Height	High
Upper Riverbank Sediment	Silt/Sand
Upper Riverbank Vegetation	Heavy
Lower Riverbank Slope	Moderate
Lower Riverbank Sediment	Bedrock
Lower Riverbank Vegetation	None to very sparse
Type of Erosion	
Potential Erosion Indicators	None
Stage of Erosion	Stable
Extent of Erosion	None/Little

**QA Observations:** Upon review of the photos for this segment, classification made in the field was confirmed.



Photo 1004 Location





Photo ID 1036 (near right, U/S portion of segment)





Photo ID 1035 (D/S)



Segment 450 – Right Bank

Riverbank Features	Characteristics
Upper Riverbank Slope	Moderate
Upper Riverbank Height	High
Upper Riverbank Sediment	Silt/Sand
Upper Riverbank Vegetation	Heavy
Lower Riverbank Slope	Flat/Beach
Lower Riverbank Sediment	Silt/Sand
Lower Riverbank Vegetation	None to very sparse
Type of Erosion	Undercut
Potential Erosion Indicators	Creep/Leaning trees, Exposed roots
Stage of Erosion	Stable
Extent of Erosion	None/Little

**QA Observations:** Upon review of the photos for this segment, classification made in the field was confirmed and additional indicators of potential future erosion were included.



Photo 1036 Location





Photo ID 1066 (mid-segment)





Photo ID 1064 (D/S)



Photo ID 1065 (middle)





Photo ID 1067 (middle)



Photo ID 1068 (middle)





Photo ID 1069 (U/S and includes next segment)



Segment 460 – Right Bank

Riverbank Features	Characteristics
Upper Riverbank Slope	Moderate
Upper Riverbank Height	High
Upper Riverbank Sediment	Silt/Sand
Upper Riverbank Vegetation	Heavy
Lower Riverbank Slope	Flat/Beach
Lower Riverbank Sediment	Silt/Sand
Lower Riverbank Vegetation	None to very sparse
Type of Erosion	Undercut
Potential Erosion Indicators	Creep/Leaning trees, Exposed roots
Stage of Erosion	Stable
Extent of Erosion	None/Little

**QA Observations:** Upon review of the photos for this segment, classification made in the field was confirmed and additional indicators of potential future erosion were included.



Photo 1066 Location





Photo ID 1093 (near right, U/S portion of segment)





Photo ID 1090 (D/S)



Photo ID 1091 (middle)





Photo ID 1092 (U/S)



Segment 470 – Right Bank

Riverbank Features	Characteristics
Upper Riverbank Slope	Overhanging
Upper Riverbank Height	High
Upper Riverbank Sediment	Silt/Sand
Upper Riverbank Vegetation	Heavy
Lower Riverbank Slope	Flat/Beach
Lower Riverbank Sediment	Silt/Sand
Lower Riverbank Vegetation	None to very sparse
Type of Erosion	Slide
Potential Erosion Indicators	Overhanging bank, Exposed roots, Creep/leaning trees
Stage of Erosion	Eroded
Extent of Erosion	Some

**QA Observations:** Upon review of the photos for this segment, classification made in the field was confirmed and additional indicators of potential future erosion were included.



Photo 1093 Location





Photo ID 1104 (photo covers most of segment)



Segment 480 – Right Bank


Riverbank Features	Characteristics
Upper Riverbank Slope	Steep
Upper Riverbank Height	High
Upper Riverbank Sediment	Silt/Sand
Upper Riverbank Vegetation	Moderate
Lower Riverbank Slope	Flat/Beach
Lower Riverbank Sediment	Silt/Sand
Lower Riverbank Vegetation	None to very sparse
Type of Erosion	Slide
Potential Erosion Indicators	Exposed roots, Overhanging bank, Creep/leaning trees
Stage of Erosion	Eroded
Extent of Erosion	Some

**QA Observations:** Upon review of the photos for this segment, classification made in the field was confirmed and additional indicators of potential future erosion were included.



Photo 1104 Location



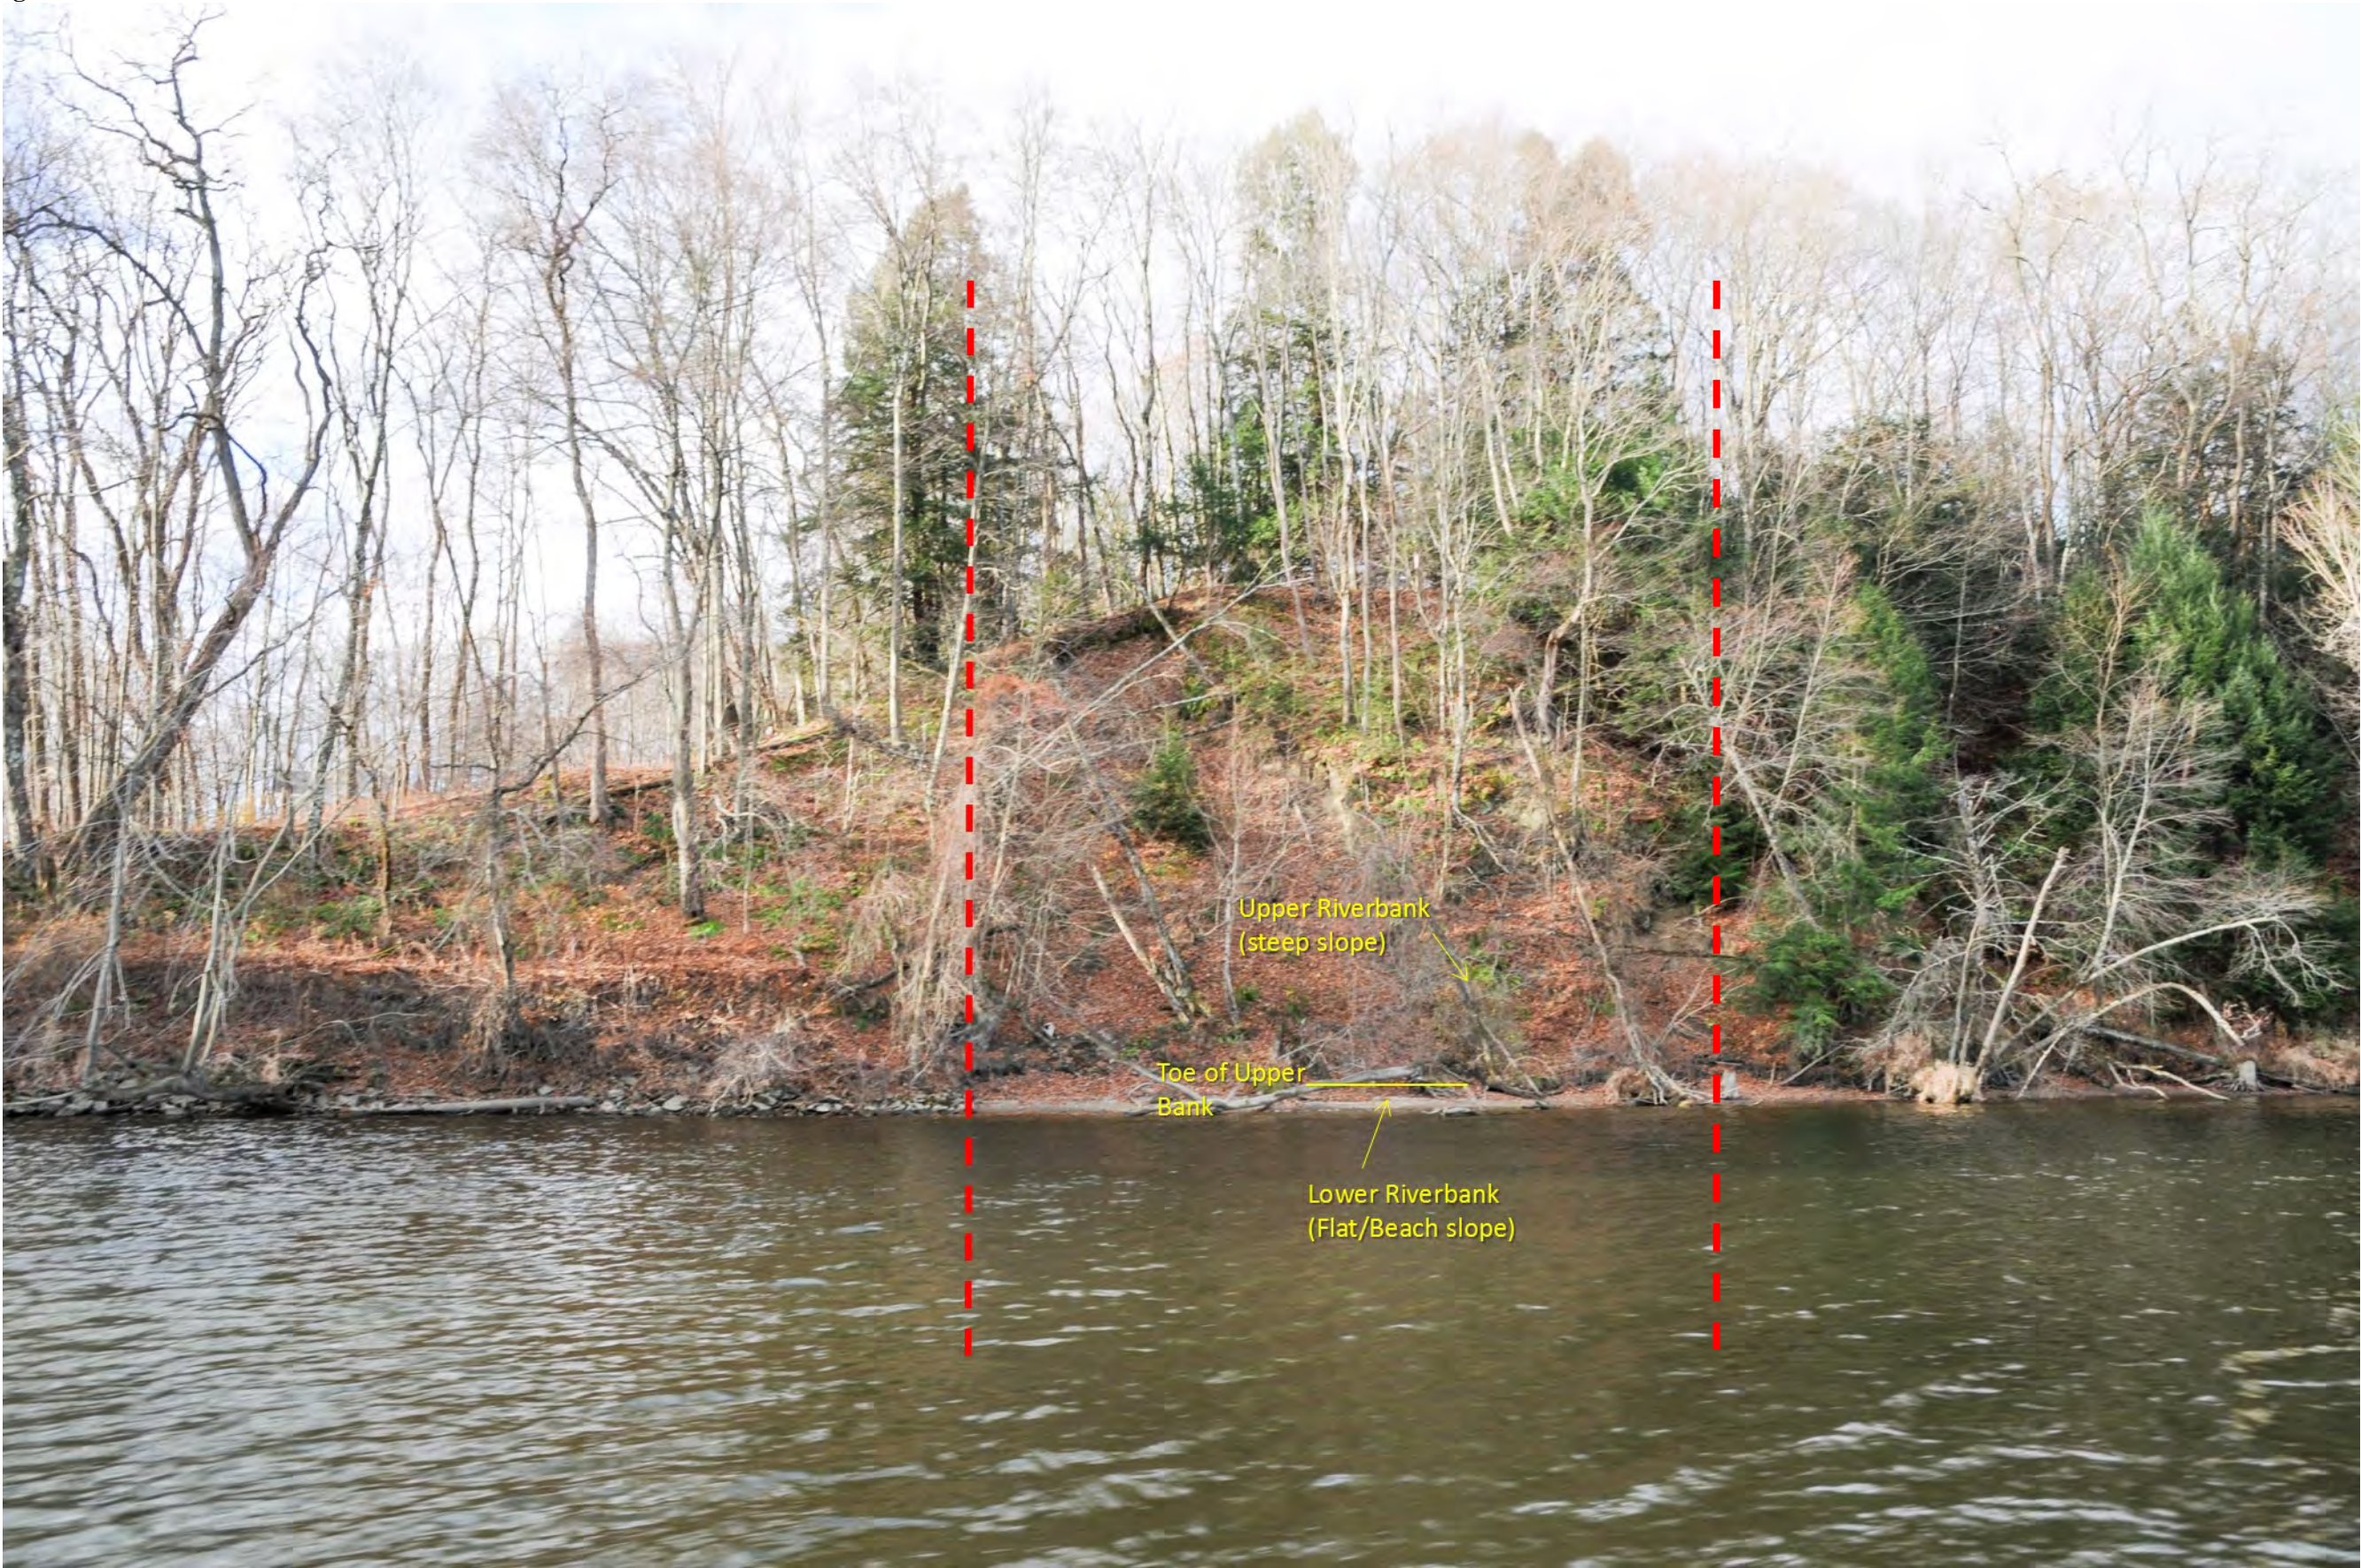

**Photo ID 1114** (segment is labeled portion of photo. Dashed line represents approximate end of segment)



Segment 490 – Right Bank

Riverbank Features	Characteristics
Upper Riverbank Slope	Steep
Upper Riverbank Height	High
Upper Riverbank Sediment	Silt/Sand
Upper Riverbank Vegetation	Moderate
Lower Riverbank Slope	Flat/Beach
Lower Riverbank Sediment	Silt/Sand
Lower Riverbank Vegetation	None to very sparse
Type of Erosion	
Potential Erosion Indicators	None
Stage of Erosion	Stable
Extent of Erosion	None/Little

**QA Observations:** Upon review of the photos for this segment, classification made in the field was confirmed.



Photo 1114 Location





Photo ID 1155 (photo covers left, D/S portion of segment)





Photo ID 1156 (U/S)



Segment 500 – Right Bank

Riverbank Features	Characteristics
Upper Riverbank Slope	Moderate
Upper Riverbank Height	High
Upper Riverbank Sediment	Silt/Sand
Upper Riverbank Vegetation	Heavy
Lower Riverbank Slope	Moderate
Lower Riverbank Sediment	Cobbles
Lower Riverbank Vegetation	None to very sparse
Type of Erosion	
Potential Erosion Indicators	None
Stage of Erosion	Stable
Extent of Erosion	None/Little

**QA Observations:** Upon review of the photos for this segment, classification made in the field was confirmed.



Photo 1155 Location





Photo ID 1183 (near mid-segment)



Segment 510 – Right Bank

Riverbank Features	Characteristics
Upper Riverbank Slope	Steep
Upper Riverbank Height	Low
Upper Riverbank Sediment	Silt/Sand
Upper Riverbank Vegetation	Heavy
Lower Riverbank Slope	Flat/Beach
Lower Riverbank Sediment	Silt/Sand
Lower Riverbank Vegetation	None to very sparse
Type of Erosion	Undercut
Potential Erosion Indicators	Creep/leaning trees
Stage of Erosion	Stable
Extent of Erosion	None/Little

**QA Observations:** Upon review of the photos for this segment, classification made in the field was confirmed.



Photo 1183 Location





Photo ID 1223 (near mid-segment)